



# CERTIFIED RADON REPORT

January 16, 2009

Test Number: 1111-1

**Property Inspected: 456 Second St, Sometown, GA 30341**

**Licensed Radalink Radon Inspector:**

**The Inspection Company**

**John Inspector**

**123 First St**

**Anytown, GA 30341**

**Phone: 770-555-1944**

**Fax: 770-555-2105**

Test performed for:

William Client

789 Third St

Sometown, GA 30314

Calibrated: 06/23/2008	Placed By: John Q Inspector (+)	Temp. Pressure R.H.
Test Started: 06/10/2008 10:48 AM	Retrieved By: John Q Inspector (+)	Min: 77.0 30.1 43
Test Ended: 06/13/2008 8:59 AM	Test Site: Unfinished Basement	Avg: 77.8 30.2 47
	Test Duration: 70 hours	Max: 80.0 30.3 48

(+)State license or certification number unavailable

## AVERAGE RADON CONCENTRATION:

**3.0 pCi/l**

Test has met minimum EPA sampling duration.

Time	06/10/2008		06/11/2008		06/12/2008		06/13/2008	
	pCi/l	Flags	pCi/l	Flags	pCi/l	Flags	pCi/l	Flags
00:48 am			2.6		2.9		2.5	
01:48			2.7		3.6		2.2	
02:48			2.4		2.1		3.5	
03:48			2.9		2.2		3.3	
04:48			3.1		3.0		3.4	
05:48			4.0		2.5		2.8	
06:48			3.5		3.2		3.4	
07:48			3.6		2.7		3.7	
08:48			3.1		3.2		3.4	
09:48			3.2		3.0			
10:48			2.8		3.5			
11:48	Eq.		2.9		3.2			
12:48 pm	Eq.		2.3		3.2			
01:48	Eq.		2.7		2.8			
02:48	Eq.		3.0		3.9			
03:48	2.4		3.1		2.7			
04:48	3.0		2.6		2.3			
05:48	3.2		4.2		3.1			
06:48	2.7		3.2		3.7			
07:48	3.4		3.4		2.4			
08:48	2.8		2.6		2.7			
09:48	2.7		3.7		2.5			
10:48	3.0		3.7		2.2			
11:48	2.6		2.7		3.1			

Flags: P= AC Power Disruption; T=Tilt  
Eq. = Equilization Period

While every effort was made to maintain optimum quality control and EPA Protocol during the testing period, neither Radalink, Inc. or its licensed agents provide any warranty, expressed or implied, for the consequences of erroneous test results. There can be some uncertainty with any measurement due to statistical variations, extreme weather changes, operation of the building, and other factors, Radalink, Inc. and its licensed operators shall not be liable under any charge or claim for losses, claims, charges, fees, demands, expenses, or damages resulting from a radon test. This report is subject to the terms on the last page of the document.

Radalink, Inc. Cert.:



**ENVIRONMENTAL DATA**

**MONITOR-TEST NUMBER: 1111-1**

**Property Inspected: 456 Second St  
Somertown, GA 30341**

Time	06/10/2008			06/11/2008			06/12/2008			06/13/2008		
	Temp	InHg	RH	Temp	InHg	RH	Temp	InHg	RH	Temp	InHg	RH
00:48 am				78.0	30.1	48	78.0	30.2	48	78.0	30.3	47
01:48				78.0	30.1	48	78.0	30.2	48	78.0	30.2	47
02:48				78.0	30.1	48	78.0	30.2	48	78.0	30.2	47
03:48				78.0	30.1	48	78.0	30.2	48	77.0	30.2	47
04:48				78.0	30.1	48	78.0	30.2	48	77.0	30.2	47
05:48				78.0	30.2	48	78.0	30.2	48	77.0	30.2	46
06:48				78.0	30.2	48	77.0	30.2	48	77.0	30.2	47
07:48				78.0	30.2	48	77.0	30.2	48	77.0	30.3	46
08:48				78.0	30.2	48	77.0	30.2	48	77.0	30.3	46
09:48				78.0	30.2	48	77.0	30.2	47			
10:48				78.0	30.1	47	77.0	30.3	47			
11:48	88.0	30.1	37	78.0	30.1	47	77.0	30.2	47			
12:48 pm	80.0	30.2	43	78.0	30.2	46	77.0	30.3	46			
01:48	79.0	30.2	45	78.0	30.2	46	77.0	30.3	46			
02:48	78.0	30.2	46	78.0	30.1	46	77.0	30.2	46			
03:48	78.0	30.1	47	78.0	30.1	47	77.0	30.2	46			
04:48	78.0	30.1	47	78.0	30.1	47	77.0	30.2	46			
05:48	78.0	30.1	47	78.0	30.1	47	77.0	30.2	46			
06:48	78.0	30.1	47	78.0	30.1	47	77.0	30.2	46			
07:48	78.0	30.1	48	78.0	30.1	47	78.0	30.2	47			
08:48	78.0	30.1	48	78.0	30.1	47	78.0	30.2	47			
09:48	78.0	30.2	48	78.0	30.1	47	78.0	30.2	47			
10:48	78.0	30.1	48	78.0	30.2	48	78.0	30.2	47			
11:48	78.0	30.2	48	78.0	30.2	48	78.0	30.3	47			

**AVERAGE RADON CONCENTRATION: 3.0 pCi/l**



Reviewed and certified by

Terry Howell, Quality Assurance Mgr.  
Radalink, Inc. NEHA 135791T




	Minimum	Average	Maximum	Variance
Temperature:	77.0	77.8	80.0	0.3
Barometric Pressure:	30.1	30.2	30.3	0.0
Relative Humidity:	43	47	48	0.86

**NOTE: The first hour's environmental data is excluded from the table above.**

Radalink, Inc. 5599 Peachtree Road Atlanta, GA 30341 Phone: (800)295-4655

GRAPHICAL DATA VIEW

MONITOR-TEST NUMBER: 1111-1

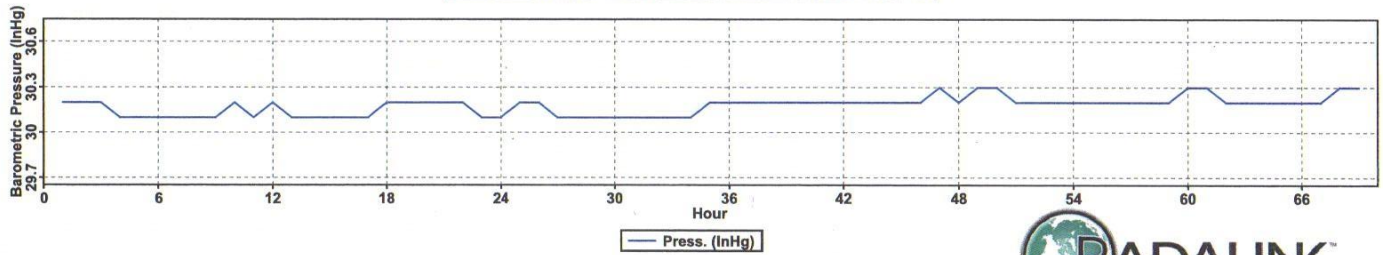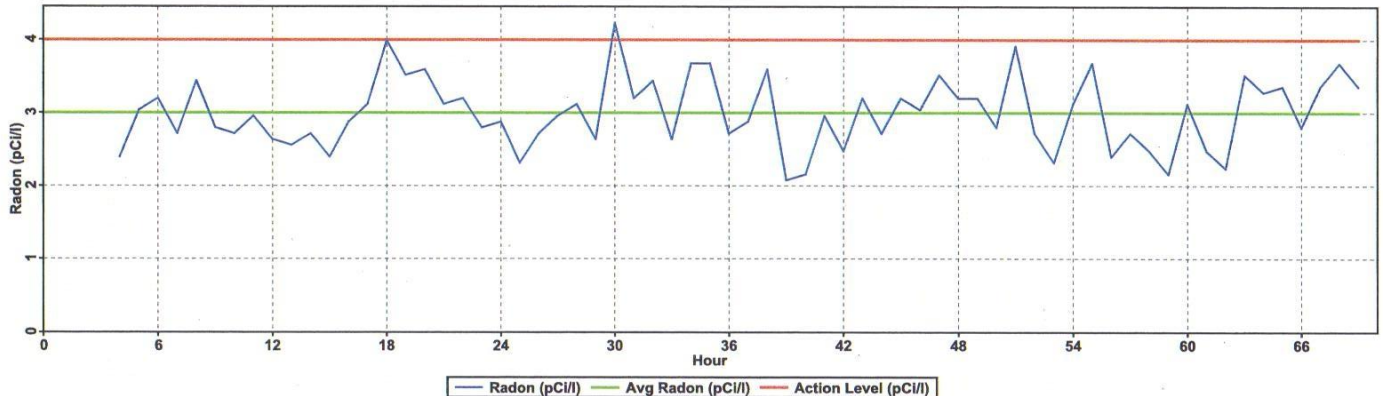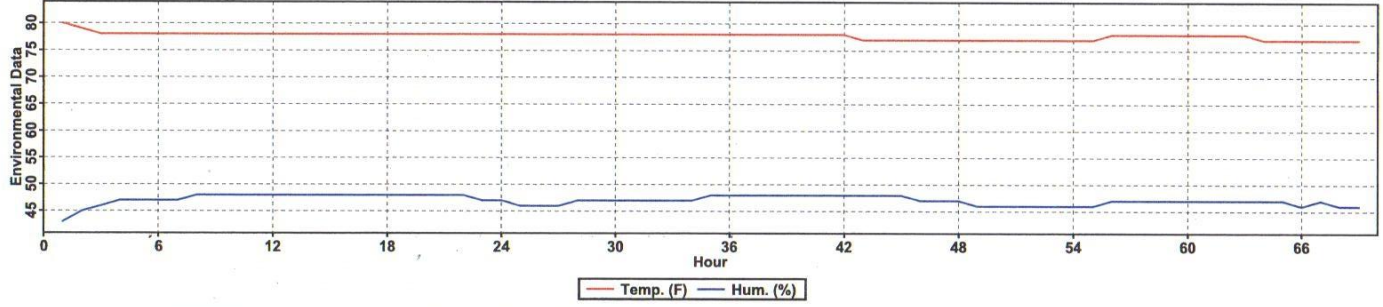

Property Inspected: 456 Second St, Sometown, GA 30341  
AVERAGE RADON CONCENTRATION: 3.0 pCi/l

